



Oostro Carpets nv
Mevr. Ellen Delbaere
Wantestraat 16
8780 OOSTROZEBEKE

Your notice of
 21-10-2019

Your reference

Date
 19-11-2019

Analysis Report 19.05953.02

Required tests :

**UK Furniture and Furnishings
 (Fire) (Safety) regulations (1988)
 No. 1324**

**The Furniture and Furnishings (Fire) (Safety) regulations :
 1988 No. 1324 - Schedule 4 part I – The cigarette test - BS 5852
 part 1 (1979)**

**UK Furniture and Furnishings
 (Fire) (Safety) regulations (1988)
 No. 1324**

**The Furniture and Furnishings (Fire) (Safety) regulations :
 1988 No. 1324 - Schedule 5 part I – The match test - BS 5852
 part 1 (1979)**

| Identification number | Information given by the client | Date of receipt |
|-----------------------|---------------------------------|-----------------|
| T1922819 | Roolf Dotty Fabric | 21-10-2019 |
| T1922841 | Filling Roolf Pouffes | 21-10-2019 |

Mike De Vrieze
 Order responsible

This report may be reproduced, as long as it is presented in its entire form, without written permission of Centexbel.
 The results of the analysis cover the received samples. Centexbel is not responsible for the representativeness of the samples.
 In assessing compliance with the specifications, we did not take into account the uncertainty on the test results.



Reference: M1922892
 T1922819 - Roof Dotty Fabric
 T1922841 - Filling Roof Pouffes

The Furniture and Furnishings (Fire) (Safety) regulations : 1988 No. 1324 - Schedule 4 part I – The cigarette test - BS 5852 part 1 (1979)

Date of ending the test 13-11-2019
 Standard used UK Furniture and Furnishings (Fire) (Safety) regulations (1988) No. 1324

Deviation from the standard -

Conditioning 23°C, relative humidity 50%


The following test results relate only to the ignitability of the combination of materials under the particular conditions of test ; they are not intended as a means of assessing the full potential fire hazard of the materials in use.

Specimens have not been cleaned

Filling T1922841

| | 1 | 2 |
|----------------------------------------|--------------|--------------|
| Smouldering criteria | | |
| Unsafe escalating combustion | no | no |
| Test assembly consumed | no | no |
| Smoulders to extremities | no | no |
| Smoulders through thickness | no | no |
| Smoulders more than 1 hour | no | no |
| Final examination / active smouldering | no | no |
| Flaming criteria | | |
| Occurence of flames | no | no |
| | | |
| | non-ignition | non-ignition |

Conclusion Pass

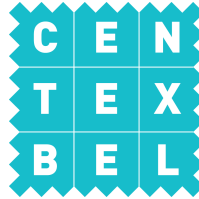

Reference: M1922892
T1922819 - Roof Dotty Fabric
T1922841 - Filling Roof Pouffes

The Furniture and Furnishings (Fire) (Safety) regulations : 1988 No. 1324 - Schedule 5 part I – The match test - BS 5852 part 1 (1979)

Date of ending the test 13-11-2019
Standard used UK Furniture and Furnishings (Fire) (Safety) regulations (1988) No. 1324

Deviation from the standard -

Conditioning 23°C, relative humidity 50%

The following test results relate only to the ignitability of the combination of materials under the particular conditions of test ; they are not intended as a means of assessing the full potential fire hazard of the materials in use.

Specimens have not been cleaned

Filling T1922841

Flame application time (s) 20

| | 1 | 2 |
|----------------------------------------|--------------|--------------|
| Smouldering criteria | | |
| Unsafe escalating combustion | no | no |
| Test assembly consumed | no | no |
| Smoke/heat/glowing more than 15 min | no | no |
| Final examination / active smouldering | no | no |
| Flaming criteria | | |
| Unsafe escalating combustion | no | no |
| Test assembly consumed | no | no |
| Flaming > 120 s | no | no |
| Afterflame time (s) | 4 | 0 |
| | | |
| | non-ignition | non-ignition |

Conclusion Pass